

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT

ORIGINAL

FIELD NOTES

OF

THE DEPENDENT RESURVEY OF

A PORTION OF THE SOUTH BOUNDARY,

A PORTION OF THE SUBDIVISIONAL LINES,

AND

THE SUBDIVISION OF SECTIONS 27, 34 AND 35

IN

TOWNSHIP 31 SOUTH, RANGE 2 WEST

OF THE SALT LAKE MERIDIAN  
IN THE STATE OF UTAH

EXECUTED BY

*Larry V. Judd*  
*Cadastral Surveyor*

Under special instructions dated *February 24, 1997*, approved *April 28, 1997*, which provided for the surveys included under Group Number *869*, and assignment instructions dated *April 30, 1997*

Survey commenced *May 27, 1997*  
Survey completed *June 16, 1997*

Township 31 South , Range 2 West

The Subdivision of Section 27.....Page 12  
The Subdivision of Section 34.....Page 13  
The Subdivision of Section 35.....Page 14

## TOWNSHIP 31 SOUTH, RANGE 2 WEST, SALT LAKE MERIDIAN, UTAH

The following field notes are those of the dependent resurvey of a portion of the south boundary, a portion of the subdivisional lines, and the subdivision of sections 27, 34 and 35, in Township 31 South, Range 2 West, Salt Lake Meridian, Utah.

## History of Surveys

Surveyed by			Retr. or Resurveyed by	
SOUTH BOUNDARY				
Portion	T.C. Bailey	1876		
All	Thoma & Bunbury	1913-15	Thoma & Bunbury	1913-15
EAST BOUNDARY				
Portion	Bailey & Burrill	1874		
All	Thoma & Bunbury	1913-15	Thoma & Bunbury	1913-15
WEST BOUNDARY				
All	Thoma & Bunbury	1913-15		
NORTH BOUNDARY				
Portion	Bailey & Burrill	1874		
Portion	Breckon & McCarty	1897	Breckon & McCarty	1897
Portion			Thoma & Bunbury	1913-15
SUBDIVISION				
Portion	Bailey & Burrill	1874		
Portion	T.C. Bailey	1876		
Portion	Thoma & Bunbury	1913-15	Thoma & Bunbury	1913-15
Portion			R.C. Yundt	1949
Portion			L.V. Judd	1996

## REMONUMENTATION

The corner of sections 10, 11, 14 and 15, was remonumented by F.D. Reynolds in 1972.

The survey was executed in accordance with the specifications set forth in the Manual of Surveying Instructions, 1973, and the Special Instructions for Group No. 869, Utah, dated February 24, 1997.

The directions of lines were determined by references to true meridians established on line by hour angle observations of the sun and Polaris. The lines were carried forward by sustained angulation, being supplemented by other observations taken throughout the progress of the survey. Distances were determined by electronic measurement.

## TOWNSHIP 31 SOUTH, RANGE 2 WEST, SALT LAKE MERIDIAN, UTAH

Preliminary to the resurvey, retracement and survey, the lines of the prior surveys were retraced and a diligent search was made for all corners and other calls of record. Identified corners were remonumented in their original positions. The retracement data were thoroughly verified and only the true line field notes are given herein.

Geodetic control was derived from U.S. Geological Survey triangulation station "ANTIMONY", with published data as follows:

Latitude 38° 07' 02.718" N. Longitude 111° 58' 45.453" W.  
N.A.D. 1927

The geographic position of the corner of sections 35 and 36 only, on the south boundary of the township, as determined by an indirect tie made to U.S. Geological Survey triangulation station "ANTIMONY", is as follows:

Latitude 38° 03' 31.05" N Longitude 111° 57' 59.59" W.  
N.A.D. 1927

The mean magnetic declination as projected from the U.S. Geological Survey Magnetic Declination Map of 1990 is 13 ½° E.

DEPENDENT RESURVEY OF A PORTION OF THE SOUTH BOUNDARY,  
T. 31 S., R. 2 W., SALT LAKE MERIDIAN, UTAH

Chains

---

Dependent Resurvey of a Portion of the South Boundary,  
T. 31 S., R.2 W., Salt Lake Meridian, Utah.

---

Reestablishment of the Survey Executed by T.C. Bailey in 1876  
and the Retracement by Thoma and Bunbury in 1913-15

---

Beginning at the corner of sections 35 and 36 only, on the south boundary of the township, monumented with a limestone, 16x10x8 ins., firmly set, plainly marked with 5 notches on the west and 1 notch on the east edges and with a large mound of stone to the west.

At the corner point

Set an aluminum post, 30 inches long, 2 1/2 inches diameter, 24 inches in the ground, with the aluminum cap marked:

T31S R2W  
S35/S36  
1997

Deposit the marked stone alongside the aluminum post.

Raise a mound of stone, 5 ft. base by 2 ft. high, north of the aluminum post.

The corner falls on a gradual open southwest slope.

S. 89°51.1' W., along the south boundary of section 35.

- 39.813** The 1/4 section corner of section 35 only, monumented with a limestone, 16x8x8 inches, firmly set, plainly marked 1/4 on the north face, with a mound of stone to the west.

At the corner point

Set an aluminum post, 30 inches long, 2 1/2 inches diameter, 12 inches in the ground, set in a mound of stone, with the aluminum cap marked:

T31S R2W  
1/4 S35  
1997

Deposit the marked stone alongside the aluminum post.

The corner falls on a gradual northerly slope.

---

N.89°59.9' W., beginning new measurement.

- 19.938** Point for the W 1/16 section corner of section 35 only, not monumented.

DEPENDENT RESURVEY OF A PORTION OF THE SOUTH BOUNDARY  
T. 31 S., R. 2 W., SALT LAKE MERIDIAN, UTAH

*Chains*

- 39.876** The corner of sections 34 and 35 only, monumented with an iron post, 3 inches diameter, firmly set, projecting 18 inches above ground, with the brass cap marked as described in the official record of the retracement by Thoma and Bunbury in 1913-15.

Raise a mound of stone, with a 4 ft. base, around the iron post.

---

Reestablishment of the Survey executed by Thoma and Bunbury in 1913-15.

---

N.89°55.0' W., along the south boundary of section 34.

- 13.07** Center line of a paved road, 22 feet wide, bears northeast and southwest.
- 17.41** Right bank of the east fork of the Sevier River.
- 18.08** Left bank of the east fork of the Sevier River.
- 20.010** Point for the E 1/16 section corner of section 34 only.
- Set an aluminum post, 30 inches long, 2 1/2 inches diameter, 24 inches in the ground, with the aluminum cap marked:

T31S R2W  
E 1/16 S34  
1997

The corner falls on flat sandy ground.

Set a steel fence post, alongside the aluminum post.

- 40.020** The 1/4 section corner of section 34 only, monumented with an iron post, 1 inch in diameter, firmly set, projecting 18 inches above ground, with the brass cap marked as described in the official record of the survey by Thoma and Bunbury in 1913-15.

---

N.89°58.8' W., beginning new measurement.

- 40.032** The corner of sections 33 and 34 only, on the south boundary of the township, monumented with an iron post, 3 inches diameter, firmly set in a mound of stone, with the brass cap marked as described in the official record of the survey by Thoma and Bunbury 1913-15.

DEPENDENT RESURVEY OF A PORTION OF THE SUBDIVISIONAL LINES,  
T. 31 S., R. 2 W., SALT LAKE MERIDIAN, UTAH

Chains

From which the original bearing trees

A pinon, 14 ins., diam., bears N. 50° E., 17 lks. dist.,  
scribed T31S R2W S34 BT. (Record cedar, N. 20° 15' E.,  
23 lks.).

A pinon, 14 ins., diam., bears N. 20° W., 24 lks. dist.,  
scribed T31S R2W S33 BT. (Record cedar, N. 79° 30' W.,  
16 lks.).

---

Dependent Resurvey of a Portion of the Subdivisional Lines,  
T. 31 S., R. 2 W., Salt Lake Meridian, Utah

---

Reestablishment of the Survey executed by  
Thoma and Bunbury in 1913-15

---

From the corner of sections 35 and 36 only, on the south  
boundary of the township, hereinbefore described.

N.0°01.4' W., between sections 35 and 36.

- 41.240** The 1/4 section corner of sections 35 and 36, monumented with  
an iron post, 1 inch in diameter, firmly set, projecting 8  
inches above ground, with a mound of stone, 3 ft. base, by 2  
ft. high, to the west and with the brass cap marked as  
described in the official record of the survey executed by  
Thoma and Bunbury in 1913-15.

---

N.0°05.9' W., beginning new measurement.

- 41.175** The closing corner of sections 35 and 36, on the south boundary  
of section 26, monumented with an iron post, 2 ½ inches  
diameter, firmly set, projecting 8 inches above ground, with a  
mound of stone, 3 ft. base, by 2 ft. high, to the south of the  
iron post, and with the brass cap marked as described in the  
official record of the survey executed by Thoma and Bunbury in  
1913-15.

---

Reestablishment of the Survey executed by T.C. Bailey in 1876,  
and the Resurvey by Thoma and Bunbury in 1913-15

---

From the corner of sections 34 and 35 only, on the south  
boundary of the township, hereinbefore described.

N.2°20.0' E., between sections 34 and 35.

- 9.78** Center line of a paved road, 22 feet wide, bears northeast and  
southwest.
- 13.84** Right bank of the east fork of the Sevier River.

DEPENDENT RESURVEY OF A PORTION OF THE SUBDIVISIONAL LINES  
T. 31 S., R. 2 W., SALT LAKE MERIDIAN, UTAH

*Chains*

**14.35** Left bank of the east fork of the Sevier River.

**19.897** Point for the S 1/16 section corner of sections 34 and 35.

Set a rebar, 3/4 inch diameter, 10 inches long, drilled 8 inches into a sandstone boulder, 12x8x8 feet above ground, with a 3 1/4 inches diameter aluminum cap marked:

S 1/16  
S34 | S35  
1997

The corner falls on the north edge of the top side of the sandstone boulder, approximately 1 chain north of the toe of the slope.

**39.794** The 1/4 section corner of sections 34 and 35, monumented with a granite stone, 16x12x6 inches, laying loose in a scattered mound of stone, plainly marked 1/4 on one of the edges.

At the corner point

Set an aluminum post, 30 inches long, 2 1/2 inches diameter, 24 inches in the ground, with the aluminum cap marked:

T31S R2W  
1/4  
S34 | S35  
1997

Deposit the marked stone alongside the aluminum post.

Raise a mound of stone, 4 ft. base by 2 ft. high, west of the aluminum post.

The corner falls on a flat rocky bench, 50 feet south of a dirt road, 13 feet wide, bears N. 50° E., and S. 50° W.

---

N.1°34.3' W., beginning new measurement.

**20.451** Point for the N 1/16 section corner of sections 34 and 35.

Set an aluminum post, 30 inches long, 2 1/2 inches diameter, 24 inches in the ground, with the aluminum cap marked:

N 1/16  
S34 | S35  
1997

Raise a mound of stone, 2 ft. base by 1 ft. high, west of the aluminum post.

Set a steel fence post alongside the aluminum post.

The corner falls on a gradual east slope.

DEPENDENT RESURVEY OF A PORTION OF THE SUBDIVISIONAL LINES  
T. 31 S., R. 2 W., SALT LAKE MERIDIAN, UTAH

*Chains*

- 40.902** The corner of sections 26, 27, 34 and 35, monumented with an iron post, 2 inches diameter, loosely set, projecting 20 inches above ground, with the brass cap marked as described in the official record of the resurvey executed by Thoma and Bunbury in 1913-15. Reset the iron post to project 2 inches above ground.

The corner falls in a fence line, projecting north and south.

---

Reestablishment of the Survey executed by Bailey and Burrill in 1874, and the Resurvey by Thoma and Bunbury in 1913-15, and the Resurvey by R.C. Yundt in 1949.

---

From the corner of sections 25 and 26 only, monumented with a limestone, 16x10x7 inches laying loose on the east side of a mound of stone, marked with 1 faint notch on the south and 1 plain notch on the east edges.

At the corner point

Set an aluminum post, 30 inches long, 2 1/2 inches diameter, 24 inches in the ground, with the aluminum cap marked:

T31S R2W  
S26 | S25  
1997

Deposit the marked stone alongside the aluminum post.

Raise a mound of stone, 5 ft. base by 2 ft. high, west of the aluminum post.

The corner falls on a gradual northeast slope on top of a finger ridge.

S. 88°16.2' W., between sections 26 and 36.

- 1.133** The closing corner of sections 35 and 36, hereinbefore described.  
Continue between sections 26 and 35.

- 40.160** The 1/4 section corner of sections 26 and 35, monumented with an iron post, 1 inch in diameter, firmly set in a mound of stone, with the brass cap marked as described in the official record of the resurvey by R.C. Yundt in 1949.

---

S. 88° 59.1' W., beginning new measurement.

- 20.032** The W 1/16 section corner of sections 26 and 35, monumented with an iron post, 1 inch in diameter, firmly set, 30 ins. below ground, with the brass cap marked as described in the official record of the resurvey by R.C. Yundt in 1949.

The corner falls within cultivated land.

---

DEPENDENT RESURVEY OF A PORTION OF THE SUBDIVISIONAL LINES  
T. 31 S., R. 2 W., SALT LAKE MERIDIAN, UTAH

*Chains*

S. 89° 02.6' W., beginning new measurement.

**20.051** The corner of sections 26, 27, 34 and 35.

---

N.1°52.7' W., between sections 26 and 27.

**19.900** Point for the S 1/16 section corner of sections 26 and 27, at proportionate distance. The 1 inch diameter iron post as set by R.C. Yundt in 1949 was found bent and laying loose nearby. The original point of this monument could not be determined and therefore not utilized.

Set an aluminum post, 30 inches long, 2 1/2 inches diameter, 24 inches in the ground, with the aluminum cap marked:

S 1/16  
S27 | S26  
1997

Buried the iron post alongside the aluminum post.

Set a steel fence post alongside the aluminum post.

The corner falls in cultivated land.

From this corner, the corner of fences, projecting N. 4° W., and S. 4° E., bears S. 82°43' W., 80 links distance.

**39.800** The 1/4 section corner of sections 26 and 27, monumented with an iron post, 1 inch in diameter, firmly set, projecting 7 inches above ground, with the brass cap marked as described in the official record of the resurvey executed by R.C. Yundt in 1949.

The corner is set in a fence line, projecting east and west.

---

Reestablishment of the Survey Executed by Thoma and Bunbury  
in 1913-15.

---

From the corner of sections 33 and 34 only, on the south boundary of the township, hereinbefore described.

N. 0° 05.7' W., on the east boundary of section 33.

**39.787** The 1/4 section corner of section 33 only, monumented with an iron post, 1 inch in diameter, firmly set, projecting 12 inches above ground, with the brass cap marked as described in the official record of the resurvey by Thoma and Bunbury in 1913-15.

No remaining evidence of the original bearing tree was found.

Raise a mound of stone, west of the iron post.

DEPENDENT RESURVEY OF A PORTION OF THE SUBDIVISIONAL LINES  
T. 31 S., R. 2 W., SALT LAKE MERIDIAN, UTAH

Chains

---

N. 0°05.8' W., beginning new measurement.

- 0.496 True Point for the 1/4 section corner of section 34 only.

From this point, the 1/4 section corner of section 34 only, monumented with an iron post, 1 inch in diameter, firmly set, projecting 12 inches above ground, with the brass cap marked as described in the official record of the resurvey by Thoma and Bunbury in 1913-15, bears N. 89° 35.0' W., 0.079 chains distance. No remaining evidence of the original bearing tree was found. Added the marks AM 1997 to the brass cap, and buried the iron post.

At the true corner point.

Set an aluminum post, 30 inches long, 2 1/2 inches diameter, 26 inches in the ground, with the aluminum cap marked:

T31S R2W  
| 1/4  
| S34  
1997

Raise a mound of stone, 4 ft. base by 2 ft. high, east of the aluminum post.

The corner falls on a gradual northeast slope.

- 40.024 The corner of sections 28 and 33 only, monumented with an iron post, 2 inches diameter, firmly set, projecting 12 inches above ground, with the brass cap marked as described in the official record of the survey by Thoma and Bunbury in 1913-15.

From which the original bearing trees

A juniper, 12 ins., diam., bears N. 58°30' W., 42 lks. dist., with scribe marks visible. (Record 41 lks.).

A juniper, 11 ins., diam., bears N. 51° W., 29 lks. dist., with scribe marks visible (Record 27 lks.).

---

N. 0°28.2' E., on the east boundary of section 28.

- 0.871 True point for the closing corner of sections 27 and 34, not monumented.

From this point, the closing corner of sections 27 and 34, monumented with an iron post, 2 inches diameter, loosely set in a mound of stone, with the brass cap marked as described in the official record of the survey by Thoma and Bunbury in 1913-15, bears S. 89° 42.0' W., 0.017 chains distance

From which the original bearing tree

A juniper, 16 ins., diam., bears S. 53°16' E., 80 lks. dist., scribed T31S R2W S34 BT.

DEPENDENT RESURVEY OF A PORTION OF THE SUBDIVISIONAL LINES  
T. 31 S., R. 2 W., SALT LAKE MERIDIAN, UTAH

Chains

No remaining evidence of the other original bearing tree was found.

Firmly mound in the iron post and add the marks AM 1997 to the brass cap.

- 40.046** The 1/4 section corner of section 28 only, monumented with an iron post, 1 inch in diameter, firmly set in a mound of stone, with the brass cap marked as described in the official record of the survey by Thoma and Bunbury in 1913-15.

No remaining evidence of the original bearing tree was found.

The corner falls on the north edge of an old trail road, 7 feet wide, bears N. 48° E., and S. 48° W.

---

N. 0°05.9' E., beginning new measurement.

- 1.063** The 1/4 section corner of section 27 only, monumented with an iron post, 1 inch in diameter, loosely set in a mound of stone, with the brass cap marked as described in the official record of the survey by Thoma and Bunbury in 1913-15.

From which the original bearing tree.

A juniper, 18ins., diam., bears S. 29°15' E., 51 lks.  
dist., scribed 1/4 S27 BT. (Record S. 27° E., 52 lks)

Raise a mound of stone, 5 ft. base around the iron post.

- 39.713** The corner of sections 21 and 28 only, monumented with an iron post, 2 inches diameter, firmly set, projecting 16 inches above ground, in a collar of stone, with a mound of stone, 2 ft. base by 2 ft. high, west of the iron post, and with the brass cap marked as described in the official record of the survey by Thoma and Bunbury in 1913-15.

From which the original bearing tree.

A pinon, 18ins., diam., bears N. 29° W., 28 lks.  
dist., with full scribe visible. (Record S. 30°30' W.)

---

N. 0°06.2' E., on the east boundary of section 21.

- 1.185** The closing corner of sections 22 and 27, monumented with an iron post, 2 inches diameter, firmly set in a mound of stone, with the brass cap marked as described in the official record of the survey by Thoma and Bunbury in 1913-15.

The original SE pinon bearing tree was found but not remeasured.

No remaining evidence of the original NE bearing tree was found.

DEPENDENT RESURVEY OF A PORTION OF THE SUBDIVISIONAL LINES  
T. 31 S., R. 2 W., SALT LAKE MERIDIAN, UTAH

Chains

- 40.079** The 1/4 section corner of section 21 only, monumented with an iron post, 1 inch in diameter, firmly set, projecting 16 inches above ground, set in a mound of stone, with the brass cap marked as described in the official record of the survey by Thoma and Bunbury in 1913-15.

No remaining evidence of the original bearing tree was found.

From this corner:

U.S. Geological Survey triangulation station "Antimony", bears N. 39° 30.7' E., ( forward bearing ) and S. 39° 31.6' W., ( back bearing ), 161.846 chains distance, monumented with a standard disk, 3 1/2 inches diameter, firmly cemented into a drill hole in lava stone, set flush on the edge of a rim, with the disk marked ANTIMONY 1969 and a triangle.

---

Reestablishment of the Survey Executed by Bailey and Burrill in 1874, and the Resurvey by Thoma and Bunbury in 1913-15.

---

From the corner of sections 26, 27, 34 and 35.

N. 89°32.5' W., between sections, 27 and 34.

- 39.903** The 1/4 section corner of sections 27 and 34, monumented with an iron post, 1 inch in diameter, firmly set, projecting 12 inches above ground, with the brass cap marked as described in the official record of the resurvey by Thoma and Bunbury in 1913-15.

From which the original bearing trees.

A pinon, 15ins., diam., bears S. 20° W., 24 lks. dist., with visible scribe marks. ( Record S. 60° 15'W., 22 lks)

A pinon, 21ins., diam., bears N. 14° W., 12 lks. dist., scribed X 27 BT ( Record N. 11° E., marked 1/4 S27 BT)

Raise a mound of stone, 3 ft. base, by 3 ft. high, north of the iron post.

---

Reestablishment of the Survey Executed by Thoma and Bunbury in 1913-15.

---

S. 89°42.0' W., beginning new measurement.

- 40.760** The true point for the closing corner of sections 27 and 34, hereinbefore described.
-

DEPENDENT RESURVEY OF A PORTION OF THE SUBDIVISIONAL LINES  
T. 31 S., R. 2 W., SALT LAKE MERIDIAN, UTAH

*Chains*

From the 1/4 section corner of sections 22 and 27, monumented with an iron post, 1 inch in diameter, firmly set, projecting 20 inches above ground, with the brass cap marked as described in the official record of the survey by Thoma and Bunbury in 1913-15.

The original bearing trees were found down and dead.

Raise a mound of stone, 4 ft. base around the iron post.

N. 89°57.5' W., between sections 22 and 27.

- 37.761** The closing corner of sections 22 and 27, hereinbefore described.

---

The Subdivision of Section 27,  
T. 31 S., R. 2 W., Salt Lake Meridian, Utah

---

From the 1/4 section corner of sections 27 and 34.

N. 1°51.8' W., on the N - S center line of section 27.

- 19.883** Point for the center S 1 /16 section corner of section 27.

Set an aluminum post, 30 inches long, 2 1/2 inches diameter, 24 inches in the ground, with the aluminum cap marked:

C  
S 1/16 | S27  
C  
1997

The corner falls in the river bottom area of the east fork of the Sevier River.

- 39.766** Point for the center 1 /4 section corner, at intersection with the E - W center line of section 27.

Set an aluminum post, 30 inches long, 2 1/2 inches diameter, 24 inches in the ground, with the aluminum cap marked:

T31S R2W  
C 1/4  
S27  
1997

Set a steel fence post alongside the aluminum post.

The corner falls in the river bottom area of the east fork of the Sevier River, 1 chain north of a newer fence, projecting east and west. The fence ends at the river to the east, and ends at the ledges to the west.

- 79.874** The 1/4 section corner of sections 22 and 27.
-

THE SUBDIVISION OF SECTION 27,  
T. 31 S., R. 2 W., SALT LAKE MERIDIAN, UTAH

*Chains*

From the 1/4 section corner of sections 26 and 27.

N. 89° 35.6' W., on the E - W center line of section 27.

**39.888** The center 1/4 section corner of section 27.

**79.027** The 1/4 section corner of section 27 only.

---

From the S 1/16 section corner of sections 26 and 27.

N. 89° 34.0' W., on the E - W center line of the SE 1/4 of section 27.

**39.896** The center S 1/16 section corner of section 27.

---

The Subdivision of Section 34,  
T. 31 S., R. 2 W., Salt Lake Meridian, Utah

---

From the 1/4 section corner of section 34 only, on the south boundary of the township, hereinbefore described.

N. 0°25.9' E., on the N - S center line of section 34.

**40.005** Point for the center 1 /4 section corner, at intersection with the E - W center line of section 34.

Set an aluminum post, 30 inches long, 2 1/2 inches diameter, 24 inches in the ground, with the aluminum cap marked:

T31S R2W  
C 1/4  
S34  
1997

Raise a mound of stone, 5 ft. base, by 2 ft. high, west of the aluminum post.

**80.912** The 1/4 section corner of sections 27 and 34.

---

From the 1/4 section corner of sections 34 and 35.

N. 89°35.0' W., on the E - W center line of section 34.

**20.669** Point for the center E 1/16 section corner of section 34.

Set an aluminum post, 30 ins., long, 2 ½ ins. diam., 24 ins., in the ground, with the aluminum cap marked:

E 1/16  
C — C  
S34  
1997

THE SUBDIVISION OF SECTION 34,  
T. 31 S., R. 2 W., SALT LAKE MERIDIAN, UTAH

*Chains*

Raise a mound of stone, 4 ft. base, by 2 ft. high, north of the aluminum post.

41.338 The center 1/4 section corner of section 34.

81.734 The 1/4 section corner of section 34 only, hereinbefore described.

---

From the E 1/16 section corner of section 34 only, on the south boundary of the township, hereinbefore described.

N. 1° 22.8' E., on the N - S center line of the SE 1/4 of section 34.

39.894 The center E 1/16 section corner of section 34.

---

The Subdivision of Section 35,  
T. 31 S., R. 2 W., Salt Lake Meridian, Utah

---

From the 1/4 section corner of section 35 only, on the south boundary of the township, hereinbefore described.

N. 0°29.9' E., on the N - S center line of section 35.

20.273 Point for the center S 1/16 section corner of section 35, not monumented.

40.546 Point for the center 1 /4 section corner, at intersection with the E - W center line of section 35.

Set an aluminum post, 30 inches long, 2 1/2 inches diameter, 24 inches in the ground, with the aluminum cap marked:

T31S R2W  
C 1/4  
S35  
1997

The corner falls on a steep, west slope.

45.515 Center line of a paved road, 23 feet wide, bears northeast and southwest.

60.945 Point for the center N 1/16 section corner of section 35, not monumented.

72.485 Center line of a paved road, 23 feet wide, bears northwest and southeast.

81.344 The 1/4 section corner of sections 26 and 35.

---

From the 1/4 section corner of section 35 and 36.

THE SUBDIVISION OF SECTION 35,  
T. 31 S., R. 2 W., SALT LAKE MERIDIAN, UTAH

*Chains*

S. 88° 50.4' W., on the E - W center line of section 35.

**39.447** The center 1/4 section corner of section 35.

**45.875** Center line of a paved road, 23 feet wide, bears northeast and southwest.

**58.753** Point for the center W 1/16 section corner of section 35.

Set an aluminum post, 30 ins., long, 2 ½ ins. diam., 20 ins. in the ground, set in a mound of stone, 3 ft. base to top of the aluminum cap marked:

W 1/16  
C ——— C  
S35  
1997

**78.059** The 1/4 section corner of sections 34 and 35.

---

From the point for the W 1/16 section corner of section 35 only, on the south boundary of the township, hereinbefore described.

N. 1°24.4' E., on the N - S center line of the SW 1/4 of section 35.

**20.083** Point for the SW 1/16 section corner, at intersection with the E - W center line of the SW 1/4 of section 35.

Set an aluminum post, 30 ins., long, 2 ½ ins. diam., 20 ins. in the ground, set in a mound of stone, 4 ft. base to top of the aluminum cap marked:

SW 1/16  
S35  
1997

The corner falls on the westerly slope of a ridge.

**40.166** The center W 1/16 section corner of section 35.

---

From the point for the center S 1/16 section corner of section 35.

S. 89° 25.8' W., on the E - W center line of the SW 1/4 of section 35.

**19.621** The SW 1/16 section corner of section 35.

**39.242** The S 1/16 section corner of sections 34 and 35.

---

From the center W 1/16 section corner of section 35.

THE SUBDIVISION OF SECTION 35,  
T. 31 S., R. 2 W., SALT LAKE MERIDIAN, UTAH

*Chains*

N. 0° 31.5' W., on the N - S center line of the NW 1/4 of section 35.

- 20.422** Point for the NW 1/16 section corner, at intersection with the E - W center line of the NW 1/4 of section 35.

Set an aluminum post, 30 ins., long, 2 ½ ins. diam., 26 ins. in the ground, with the aluminum cap marked:

NW 1/16  
S35  
1997

The corner falls within a cultivated field.

- 40.834** The W 1/16 section corner of sections 26 and 35.

---

From the point for the center N 1/16 section corner of section 35.

S. 88°55.7' W., on the E - W center line of the NW 1/4 of section 35.

- 19.669** The NW 1/16 section corner of section 35.

- 39.347** The N 1/16 section corner of sections 34 and 35.
-

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT

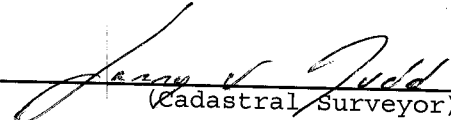
**FIELD ASSISTANTS**

Name	Capacity
Brandon S. Sanchez Steven Oatman Shane Chamberlin	Surveying Technician Surveying Technician Survey Aid

## CERTIFICATE OF SURVEY

I, **Larry V. Judd, Cadastral Surveyor**, hereby certify upon honor that, in pursuance of special instructions bearing the date of the **24h day of February, 1997**, I have **executed a dependent resurvey of a portion of the south boundary, a portion of the subdivisional lines, and the subdivision of sections 27, 34 and 35, in Township 31 South, Range 2 West, of the Salt Lake Meridian**, in the State of **Utah**, which are represented in the foregoing field notes as having been executed by me and under my direction; and that said survey has been made in strict conformity with said special instructions, the Manual of Instructions for the Survey of the Public Lands of the United States, and in specific manner described in the foregoing field notes.

4/10/02  
Date

  
(Cadastral Surveyor)

\_\_\_\_\_  
Date

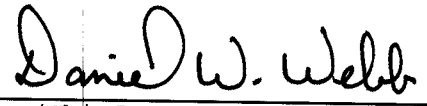
\_\_\_\_\_  
(Cadastral Surveyor)

## CERTIFICATE OF APPROVAL

BUREAU OF LAND MANAGEMENT  
Salt Lake City, Utah

The foregoing field notes of the **dependent resurvey of a portion of the south boundary, a portion of the subdivisional lines and the subdivision of sections 27, 34 and 35, in Township 31 South, Range 2 West**, executed by **Larry V. Judd, Cadastral Surveyor** having been critically examined and found correct, are hereby approved.

April 23, 2002  
Date

  
(Chief Cadastral Surveyor for Utah)